


Combination Photo-Tachometer Stroboscope

Model 461825

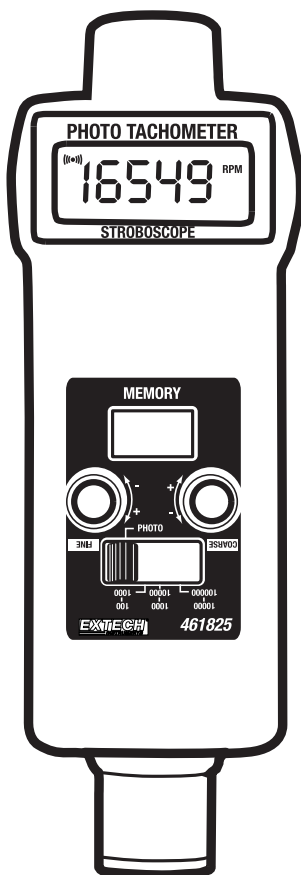


Introduction

Congratulations on your purchase of Extech's Combination Photo-Tachometer/Stroboscope. This device is shipped fully tested and calibrated and, with proper use, will provide years of reliable service. Please visit our website (www.extech.com) to check for the latest version of this User Guide, Product Updates, and Customer Support.

Meter Description

1. Tachometer Light Source
2. LCD Display
3. Measure trigger button
4. Memory Recall button
5. FINE adjust knob
6. COARSE adjust knob
7. Range/Function select switch
8. Stroboscope flash tube

Note: Battery compartment is on rear of meter

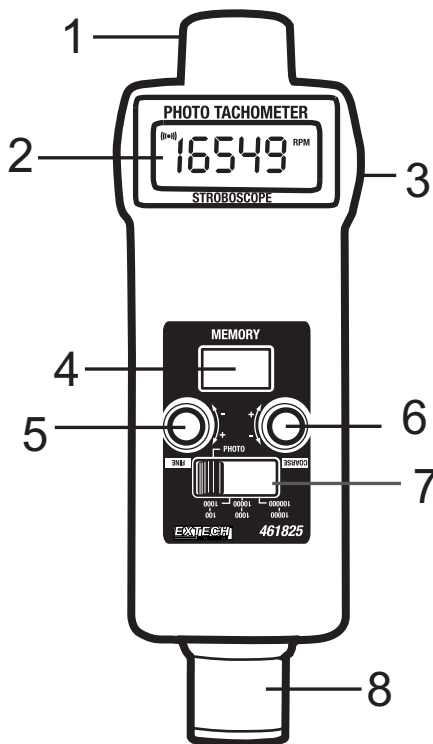

Disposal: Follow the valid legal stipulations in respect of the disposal of the device at the end of its lifecycle

STROBOSCOPE MEASUREMENT PROCEDURE

Select the Stroboscope Function and Range using the Range/Function Select Switch. The switch has four positions, three of which are stroboscope-dedicated with white range numbers. The fourth position is Photo-Tachometer dedicated and is labeled as such.

Speed Measurements.

1. Remove power to the moving object under test and affix a target mark on the area to be measured.
2. Apply power to the moving object and press the stroboscope's Measure Trigger Button.
3. Aim the Stroboscope light beam toward the marked area on the object under test.
4. Use the FINE and COARSE adjust knobs to synchronize or "stop" the motion of the object's mark. A single stationary image of the mark provides actual speed measurement data.

NOTE: Care must be taken to ensure that the mark is providing a 1:1 measurement. This is done by checking that there is only one mark and not two, four, or more stationary marks on the object under test. Two or more stopped marks indicate "harmonic" measurements (2:1, 3:1, 4:1, etc.) which provide a doubling, tripling, or quadrupling of the actual speed. A useful method of avoiding harmonic measurements is to adjust the FINE/COARSE knobs until two images (marks) appear and then lower the flash rate (via COARSE/FINE knobs) until a single, stationary image appears. This is the actual speed.

Inspecting a moving object

Measure the speed of a moving object as described above and move the FINE adjust knob alternately higher and lower to visually inspect all areas of the device.

PHOTO-TACHOMETER MEASUREMENT PROCEDURE

1. Select the Photo-Tachometer function by moving the Range/Function select switch to the PHOTO position.
2. Affix a small piece (approx. 0.5") of supplied reflective tape to the object under test.
3. Press the meter's Measurement Trigger button and align the Photo-Tachometer light source with the reflective tape mark on the moving object.
4. Wait until the Monitor Indicator appears in the upper left hand corner of the LCD indicating that synchronization has occurred.
5. Release the Measure Trigger button only after the reading has stabilized (approx. 2 seconds).

NOTE: To obtain better accuracy for low RPM measurements (less than 50 RPM) use more than one piece of reflective tape. Divide the meter reading by the number of reflective tape pieces for accurate measurement data.

MEMORY RECORD AND RECALL

The 461825 can record Maximum, Minimum, and Last Reading for the period of time during which the Measure Trigger button is held. These stored values can then be read directly on the meter's display. The memory will automatically erase after approximately 10 seconds of meter inactivity. Access the memory data immediately after the measurements.

1. Follow the instructions for normal operation.
2. Release the Measurement Trigger button.
3. Immediately press the Memory Recall button once to display the Last Reading taken during the measurement period. 'LA' will alternately display with the data reading to indicate 'Last Reading'.
4. Release and press the Memory Recall button again to display the Maximum reading taken during the measurement period. 'UP' will alternately appear with the data reading to indicate the Maximum reading.
5. Release and press the Memory Recall button again to display the Minimum reading taken during the 30 second test period. 'dn' will alternately appear with the data reading to indicate the Minimum reading.

Specifications

General Specifications

Circuit	Custom LSI microprocessor based design
Display	Reversible, 0.4" (10mm) 5-digit (99999 count) LCD display
Measurement units	RPM (revolutions or rotations per minute)
Memory Recall	Records/Recalls Max/Min/Last readings with memory push-button
Operating Temperature	32 to 122°F (0 to 50°C)
Operating Humidity	< 80% RH
Power Supply	Four 1.5V 'AA' batteries (UM-3 or equivalent)
Weight	0.48 lbs. (216g) meter only
Dimensions	8.2 x 2.8 x 1.9" (207 x 72 x 48mm)
Accessories	Reflective tape and carrying case

Electrical Specifications

Measurement Range	5 to 99,999 RPM for the Tachometer 100 to 100,000 FPM/RPM for the Stroboscope
Resolution	0.1 RPM (<1000 RPM) and 1 RPM (> 1000 RPM)
Accuracy	± (0.1% + 2 digits)
Sampling Time	1 second (> 60 RPM)
Photo Tachometer detection distance	2 to 6" (50 to 150mm) typical <i>Note:</i> Detection distances up to 12" (300mm) are possible depending upon ambient light
Stroboscopic Flash rate	100 to 100,000 FPM (flashes per minute)
Stroboscopic Flash adjust range	Range A: 100 to 1,000 FPM Range B: 1000 to 10,000 FPM Range C: 10,000 to 100,000 FPM
Stroboscopic Flash tube type	High efficiency LED lamp
Stroboscopic Flash duration	60 to 1000 microseconds (approx. 16% of period)
Stroboscopic Flash Color	Orange

Warranty

FLIR Systems, Inc. warrants this Extech Instruments brand device to be free of defects in parts and workmanship for one year from date of shipment (a six month limited warranty applies to sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department for authorization. Visit the website www.extech.com for contact information. A Return Authorization (RA) number must be issued before any product is returned. The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. FLIR Systems, Inc. specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential damages. FLIR's total liability is limited to repair or replacement of the product. The warranty set forth above is inclusive and no other warranty, whether written or oral, is expressed or implied.

Calibration, Repair, and Customer Care Services

FLIR Systems, Inc. offers repair and calibration services for the Extech Instruments products we sell. NIST certification for most products is also provided. Call the Customer Service Department for information on calibration services available for this product. Annual calibrations should be performed to verify meter performance and accuracy. Technical support and general customer service is also provided, refer to the contact information provided below.

Support Lines: U.S. (877) 439-8324; International: +1 (603) 324-7800

Technical Support: Option 3; E-mail: support@extech.com

Repair & Returns: Option 4; E-mail: repair@extech.com

Product specifications are subject to change without notice

Please visit our website for the most up-to-date information

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

ISO 9001 Certified

Copyright © 2013 FLIR Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form

www.extech.com

Garantie

FLIR Systems, Inc. garantit que cet appareil Extech Instruments est exempt de défauts matériaux et de fabrication pendant un an à partir de la date d'envoi (une garantie limitée de six mois s'applique aux capteurs et aux câbles). Si le renvoi de l'appareil pour réparation devient nécessaire durant ou après la période de garantie, contactez le service client pour autorisation. Pour obtenir les coordonnées, visitez le site Web suivant : www.extech.com. Un numéro d'autorisation de retour (AR) doit être délivré avant tout retour de produit. L'expéditeur prend à sa charge les frais d'expédition, le fret, l'assurance et l'emballage correct de l'appareil afin de prévenir toute détérioration durant le transport. Cette garantie ne s'applique pas aux dommages imputables à l'utilisateur, tels que l'usage impropre ou abusif, un mauvais câblage, une utilisation non conforme aux spécifications, un entretien ou une réparation incorrecte, ou toute modification non autorisée. FLIR Systems, Inc. déclinera spécifiquement toute garantie ou qualité marchande ou aptitude à l'emploi prévu, et ne sera en aucun cas tenu responsable pour tout dommage conséquent, direct, indirect ou accidentel. La responsabilité totale de FLIR est limitée à la réparation ou au remplacement du produit. La garantie définie ci-dessus est inclusive et aucune autre garantie, écrite ou orale, n'est exprimée ou implicite.

Calibrage, réparation et services après-vente

FLIR Systems, Inc. offre des services de calibrage et de réparation pour les produits Extech Instruments que nous commercialisons. Nous fournissons également une certification NIST pour la plupart des produits. Contactez notre service client pour toute information sur les services de calibrage disponibles pour ce produit. Un calibrage doit être effectué chaque année pour vérifier les performances et la précision du mètre. Nous offrons également une assistance technique et un service à la clientèle. Veuillez vous reporter aux coordonnées fournies ci-dessous.

Lignes d'assistance: États-Unis (877) 439-8324; international: +1 (603) 324-7800

Service d'assistance technique : Option 3 ; E-mail : support@extech.com

Réparations et retours : Option 4 ; E-mail : repair@extech.com

Les spécifications produit sont sujettes à modifications sans préavis.

Pour les toutes dernières informations, veuillez visiter notre site Web.

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certifié ISO 9001

Copyright © 2013 FLIR Systems, Inc.

Tous droits réservés, y compris la reproduction partielle ou totale sous quelque forme que ce soit.

www.extech.com

Garantía

FLIR Systems, Inc., garantiza este dispositivo marca Extech Instruments para estar libre de defectos en partes o mano de obra durante un año a partir de la fecha de embarque (se aplica una garantía limitada de seis meses para cables y sensores). Si fuera necesario regresar el instrumento para servicio durante o después del período de garantía, llame al Departamento de Servicio a Clientes para obtener autorización. Visite www.extech.com para Información de contacto. Se debe expedir un número de Autorización de Devolución (AD) antes de regresar cualquier producto. El remitente es responsable de los gastos de embarque, flete, seguro y empaque apropiado para prevenir daños en tránsito. Esta garantía no se aplica a defectos resultantes de las acciones del usuario como el mal uso, alambrado equivocado, operación fuera de las especificaciones, mantenimiento o reparación inadecuada o modificación no autorizada. FLIR Systems, Inc., rechaza específicamente cualesquier garantías implícitas o factibilidad de comercialización o idoneidad para cualquier propósito determinado y no será responsable por cualesquier daños directos, indirectos, incidentales o consecuentes. La responsabilidad total de FLIR está limitada a la reparación o reemplazo del producto. La garantía precedente es inclusiva y no hay otra garantía ya sea escrita u oral, expresa o implícita.

Servicios de calibración, reparación y atención a clientes

FLIR Systems, Inc., ofrece servicios de reparación y calibración para los productos que vendemos de Extech Instruments. Además ofrecemos certificación NIST para la mayoría de los productos. Llame al Departamento de Servicio al Cliente para solicitar información de calibración para este producto. Para verificar el funcionamiento y precisión se debe realizar la calibración anual. Además se provee Soporte Técnico y servicios generales al cliente, consulte la información de contacto en seguida.

Líneas de soporte: EE.UU. (877) 439-8324; Internacional: +1 (603) 324-7800

Soporte Técnico Opción 3; correo electrónico: support@extech.com

Reparación / Devoluciones: Opción 4; correo electrónico: repair@extech.com

Las especificaciones del producto están sujetas a cambios sin aviso

Por favor visite nuestra página en Internet para la información más actualizada

www.extech.com

FLIR Commercial Systems, Inc., 9 Townsend West, Nashua, NH 03063 USA

Certificado ISO 9001

Copyright © 2013 FLIR Systems, Inc.

Reservados todos los derechos, incluyendo el derecho de reproducción total o parcial en cualquier medio

www.extech.com